

1-STEP HEADLIGHT RESTORATION SPRAY 1 ÉTAPE RESTAURATEUR DES PHARES DTR241 / DTR265

INSTRUCTIONAL VIDEO
VIDÉO ÉDUCATIVE



detourauto.com/guide

Ideal for light to moderate headlight oxidation.

Use by itself for a quick clarity boost or after removing oxidation for best results. Results may vary based on headlight condition.


⚠ Use only when humidity is **below 70%** and temperature is **above 10°C/50°F**. Use in sheltered area **away from wind and direct sunlight**.

1) Ensure headlights are **completely clean and dry**. Lift hood and **mask around headlights** to prevent overspray on paint/trim.

SHAKE WELL BEFORE USE

2) **HOLD CAN 8" AWAY**. Evenly spray the entire headlight surface in a grid pattern (side-to-side, then up/down).

3) **WAIT 1-2 MINUTES**, then repeat **STEP 2**.

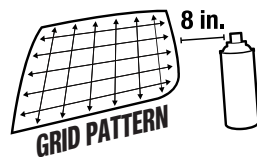

4) Repeat **STEPS 2 & 3** on the other headlight.

LET DRY, DO NOT WIPE OFF. Dry in 20 minutes. Fully cured in 24 hours. Allow to cure for at least 2 hours before exposing to water.

DTR265: After use, invert can and spray to clear valve.

Idéal pour l'oxydation légère à modérée des phares.

À utiliser seul pour redonner rapidement de la clarté ou après avoir éliminé l'oxydation pour obtenir de meilleurs résultats. Les résultats peuvent varier en fonction de l'état des phares.

⚠ Utilisez le produit lorsque le taux d'humidité est **inférieur à 70 %** et que la température est **supérieure à 10 °C/50 °F**. Garez le véhicule dans un endroit couvert à l'abri du **vent ou de la lumière directe du soleil**.

1) Assurez-vous que les phares sont **complètement propres et secs**. Ouvrez le capot et appliquez un **masque autour des phares** afin d'éviter toute pulvérisation excessive sur la peinture ou les garnitures.

BIEN AGITER AVANT USAGE

2) **TENEZ LE GÉNÉRATEUR AÉROSOL À 8 POUCE**.


Vaporisez uniformément toute la surface du phare en suivant un quadrillage (d'un côté à l'autre puis de haut en bas).

3) **ATTENDEZ 1 OU 2 MINUTES**, puis répétez **L'ÉTAPE 2**.

4) Répétez les **ÉTAPES 2 et 3** pour le deuxième phare.

Laissez sécher. N'essuyez pas. Sec en 20 minutes. Durcissement complet en 24 heures. Laissez sécher pendant 2 heures avant d'exposer à l'eau.

DTR265: Après utilisation, inverser l'aérosol et vaporiser pour nettoyer la tête de distribution.

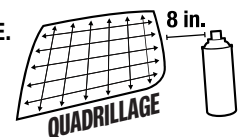

TROUBLESHOOTING:

PROBLEM	CAUSE	FIX
Haze/Blushing	Too humid, excess moisture in air	Spray when less humid. (70% or less)
Dry Spray	Coating too dry	Hold can closer to lens while applying. Slow down rate of application.
Spatter	Spray tip obstructed	Remove spray tip and clean orifice with fine wire and lacquer thinner. Spray can upside down after each use.